

Materials



OR



Step #1: Install WPS-N-4A and WPS-5



Slide the WPS-5 boot onto the 7/8" cable 8-12" from the end prior to cable prep.



Prep the 7/8" cable and install the 7/8" connector. Refer to the UXP-78 installation instructions.



Slide the 1/2" to 7/8" adaptor onto the 1/2" cable, then the WPS-N-4A 8-12" from the end prior to cable preparation.



Prep the 1/2" cable and install the 1/2" connector. Refer to the UXP-12 installation instructions. Install the port seal provided onto the N female connector. This seal is gray in color & marked "for use with connector".

Step #2: Connect and Torque Interface



Mate the male connector to the female connector.



Torque the connector to 14 in-lbs using the TW1412 torque wrench.

Step #3: Install JMA WPS to Seal Interface



Slide the WPS-N-4A over the port seal until ribs are no longer visible.



Slide the 1/2" to 7/8" adaptor over the WPS-N-4A until it bottoms against the 7/8" connector.



Slide the WPS-5 over the 1/2" to 7/8" adaptor until the WPS-5 is fully seated.